

SERVICE NOTES

Mar 10th, 2003

Page 1 of 2

FILE TITLE

Signa Ovation System

SN62723


RF Cable Connector

Overview:

If the RF cable length is too long at site, it is accepted to cut the cable at the proper length. RF connectors are included in the RF Cable kit. This document describes how to install RF connector.

Procedure:

1. Verify that the following parts are shipped.

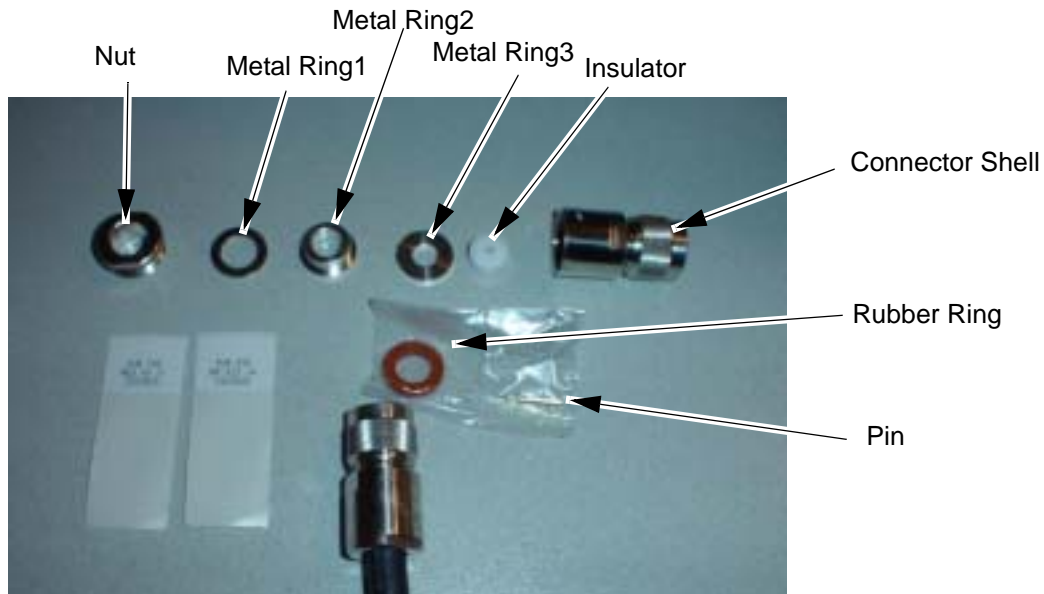


RF CABLE CONNECTOR KIT

Illustration 1

Procedure (continued):


2. Cut the outer peel of the cable about 10mm from the end.

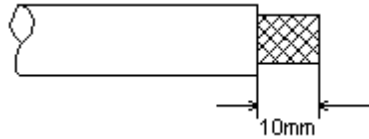

CUT OUTER PEEL

Illustration 2

3. Cut the inner insulation about 6.4 mm from the end.

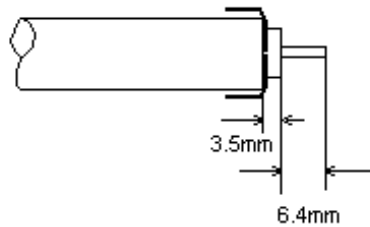


CUT INNER INSULATION

Illustration 3

4. Install the connector kit according to the following illustration.
Solder pin to the coaxial cable.



Solder here

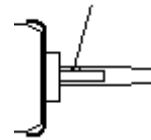

INSTALL CONNECTOR KIT

Illustration 4

5. Install connector shell and tighten it.



Connector Shell

CONNECTOR SHELL

Illustration 5

Yutaka Masumo
GEYMS TP Gr. -MR