

Notice on MFO2 Option Software Installation

Effectivity

Option software installation on MFO2 systems

Purpose

This document describes MFO2 M3 option key structure. It also describes some notices concerning MFO2 option software installation.

MFO2 M3 Option Key Structure

MFO2 M3 option key structure:

- Ovation II EPI Package
 - Side A:Echo Planer Imaging
 - Side B:DWEPI
- Ovation II FIESTA 2D/3D
 - Side A:FIESTA 2D
 - Side B:FIESTA 3D
- Ovation II Fat/Water Separation
 - Side A:Fat/Water (incl. C-Sat)
- Ovation II Rapid Frame
 - Side A:Rapid Frame
- Ovation II Scan Tool II
 - Side A:FGRE, Cine, FSE&FLAIR, TOF, SSFSE, 3P-Localizer, E3DTOF, FSE-XL, FastCine, Proactive Service
 - Side B:Voxtool
- Ovation II SW Tool
 - Side A:Image Filter
 - Side B:IVI

Option key structure that have not changed since MFO1 M4:

- Scan tools
 - Side A:Fast Gradient Echo, Cine, Fast Spin Echo & FLAIR, Time of Flight, SSFSE, Three Plane Localizer, E3D TOF, FSE-XL, Fastcine, Proactive Service
 - Side B:Vox Tool
- MFO TOOLS
 - Side A: Image Filter
 - Side B: IVI


Notice on Fiesta 3D installation

You must install FIESTA 2D **first** in order to install FIESTA 3D.


Notice on installing new option software at a site where IVI is already installed

When you are installing a new option software at a site where IVI is already installed, after you have installed the new option software, you must uninstall IVI, and then install IVI again.

When you are performing system software version up, you must install IVI **after** you installed all other options. This is because installation of option software other than IVI will overwrite a file that needs to execute the action assigned to IVI-F button. When you are performing system software version up, you do not need to uninstall IVI, because restore operation will **NOT** restore Voxtool and IVI. Just remember to install IVI **last**. Refer to the following flow chart.

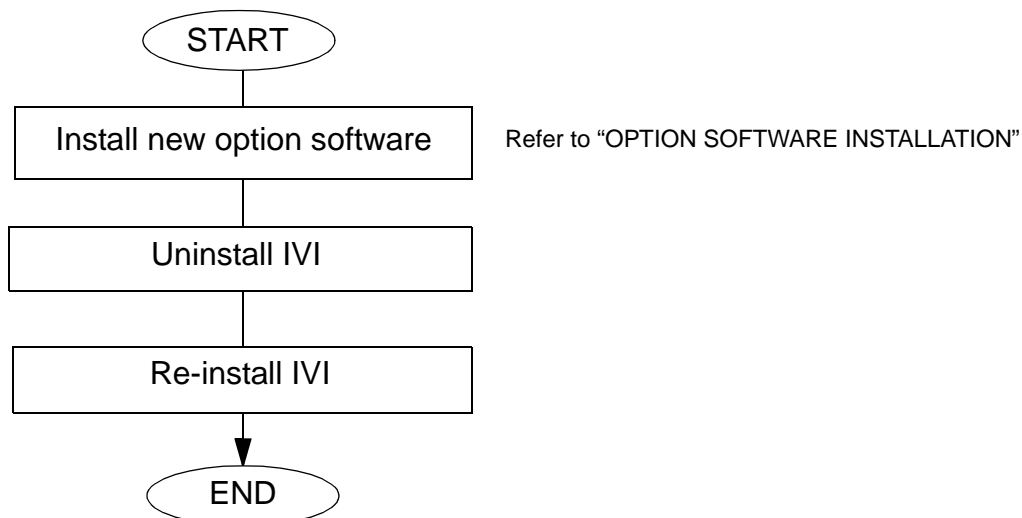

FLOW CHART OF NEW OPTION SOFTWARE INSTALLATION
ILLUSTRATION 1

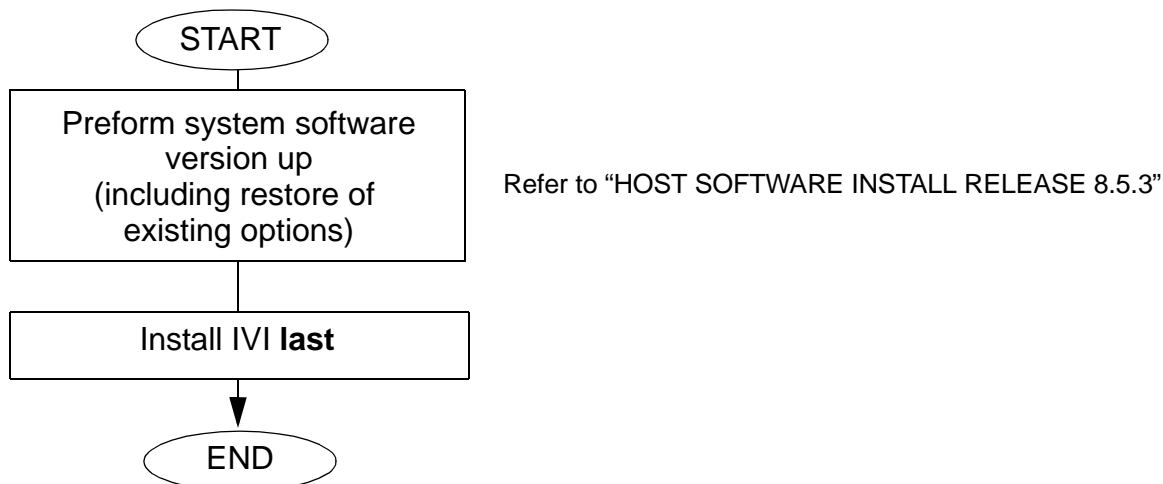

FLOW CHART OF SYSTEM SOFTWARE VERSION UP
ILLUSTRATION 2

SERVICE NOTES

May 14, 2002

Page 3 of 3

FILE TITLE

MFO System

SN62703

Note

All MFO/Profile/Contour Service Notes including this Service Note is available on WEB for GE employees. URL : <http://3.36.8.50/mr/index.html>

MR TP Gr.
Mieko Ikeda